

APPLICATION OF FASTCOTE & FASTCOTE LP

- USING A WPPP60 SYNTHETIC CLOTH, HAVE IT WET, BUT NOT DRIPPING, WIPE OVER THE SURFACE A WET FILM THAT DRIES IN AROUND 30 TO 45 SECONDS
 - LEAVE EACH COAT FOR 15 MINUTES TO CURE AFTER IT IS DRY
 - NEW & REFURBED MOULDS 2 COATS MOULD SEALER
+ 4 COATS FASTCOTE OR FASTCOTE LP

TIPS

- DO NOT WORK THE RELEASE, JUST WIPE IT OVER, MAKE SURE IT IS A CONTINUOUS WET FILM & LEAVE IT
 - NEVER RE-TOUCH A DRYING FILM
- FOR DETAILED AREAS MAKE SURE THE FINE DETAILS ARE COATED, THEN WIPE OVER THE AREA AGAIN AND LEAVE IT TO DRY
 - ANY RUNS OR STREAKS JUST RE-APPLY TO REMOVE
- IN COLDER CONDITIONS IT SHOULD DRY IN A MINUTE

WHAT TO USE IT ON
GEL COATED A SURFACE

SPACE FOR NOTES